

Active Errata List

- UART/Reception in Modes 1, 2 and 3/UART False Start Bits Detection
- During UART Reception, Clearing REN May Generate Unexpected IT
- JBC/Double IT When External IT Occurs During JBC Instruction
- Timer2/Downcounter Mode/Double IT With Slow External Clock
- Input Trigger Consumption/All C51 Type I/O Ports
- MOVX/Port0/Read Mode

Errata History

TS80C51RB2

Lot Number	Errata List
≤ 38584	T01, T02 ,T03, T04, T05, T06
> 38584	T02 ,T03, T04, T05, T06

TS87C51RB2

Lot Number	Errata List
≤ 36425	T01, T02 ,T03, T04, T05, T06
> 36425	T02 ,T03, T04, T05, T06

Errata Descriptions

1. UART/Reception in Modes 1, 2 and 3/UART False Start Bits Detection

When a false start bit occurs on the UART, some UART internal signals are not reset. Then when a real start bit occurs, the sampling is shifted.

Workaround

None.

2. During UART Reception, Clearing REN May Generate Unexpected IT

During UART reception, if the REN bit is clear between a start bit detection and the end of reception, the UART will not discard the data (RI is set).

Workaround

Test REN at the beginning of Interrupt routine just after CLR RI, and run the Interrupt routine code only if REN is set.

3. JBC/Double IT When External IT Occurs During JBC Instruction

On polling algorithm in ISR on IE1 or IE0, when the external IT appears during JBC instruction, the flag is not cleared. On the next JBC instruction another IT is pending. Therefore, the same IT is seen twice.

Workaround

Use JB Instruction instead of JBC instruction to test bit and CLR instruction to clear it.n twice.



**8051
Microcontrollers**

**TS87C51RB2
TS80C51RB2**

Errata Sheet

Rev. 4154C–8051–04/03



4. Timer2/Downcounter Mode/Double IT with Slow External Clock

Double IT with slow external clock in downcount mode. Timer 2 in 16-bit autoreload in count-down mode with external clock input two interrupts are generated successively with low frequency on clock input (typ 10-40 KHz).

Workaround

Reload FFFE into TH2-TL2 in ISR and count down to RCAP-1 (to recover cycle lost in ISR)

Caution: do not work if initially RCAP = 0x0000

5. Input Trigger Consumption/All C51 Type I/O Ports

Some static consumption in input triggers of I/O ports may occur when entries are driven close to the trigger threshold (1 mA to 2 mA for each I/O at $V_{in} = 2.4V$ for $V_{cc} = 5V$)

Workaround

None.

6. Movx/Port0/Read Mode

When reading External Ram using Movx instruction, Port0's SFR may contain '0' whereas any acces to external memories (data or program) should write '1' into them .

'0' is written to each bit of the Port0 buffers prior to a Movx access. This problem has no consequence when the Movx cycle is a write, as the correct value is immediately substituted and is present on Port0 during the duration of the write pulse ($WR = 0$). When the Movx is a read, the strong internal pull-down N transistor creates a short circuit with the external RAM buffer or peripheral when the RAM or peripheral reads '1'.

Workaround

Replace any movx A, @Ri instruction by the sequence:

```
mov P0, #FFh
```

```
movx A, @Ri
```

Replace any movx A, @DPTR instruction by the sequence:

```
mov P0, #FFh
```

```
movx A, @DPTR
```



Atmel Headquarters

Corporate Headquarters

2325 Orchard Parkway
San Jose, CA 95131
TEL 1(408) 441-0311
FAX 1(408) 487-2600

Europe

Atmel Sarl
Route des Arsenaux 41
Case Postale 80
CH-1705 Fribourg
Switzerland
TEL (41) 26-426-5555
FAX (41) 26-426-5500

Asia

Room 1219
Chinachem Golden Plaza
77 Mody Road Tsimhatsui
East Kowloon
Hong Kong
TEL (852) 2721-9778
FAX (852) 2722-1369

Japan

9F, Tonetsu Shinkawa Bldg.
1-24-8 Shinkawa
Chuo-ku, Tokyo 104-0033
Japan
TEL (81) 3-3523-3551
FAX (81) 3-3523-7581

Atmel Operations

Memory

2325 Orchard Parkway
San Jose, CA 95131
TEL 1(408) 441-0311
FAX 1(408) 436-4314

Microcontrollers

2325 Orchard Parkway
San Jose, CA 95131
TEL 1(408) 441-0311
FAX 1(408) 436-4314

La Chantryerie
BP 70602
44306 Nantes Cedex 3, France
TEL (33) 2-40-18-18-18
FAX (33) 2-40-18-19-60

ASIC/ASSP/Smart Cards

Zone Industrielle
13106 Rousset Cedex, France
TEL (33) 4-42-53-60-00
FAX (33) 4-42-53-60-01

1150 East Cheyenne Mtn. Blvd.
Colorado Springs, CO 80906
TEL 1(719) 576-3300
FAX 1(719) 540-1759

Scottish Enterprise Technology Park
Maxwell Building
East Kilbride G75 0QR, Scotland
TEL (44) 1355-803-000
FAX (44) 1355-242-743

RF/Automotive

Theresienstrasse 2
Postfach 3535
74025 Heilbronn, Germany
TEL (49) 71-31-67-0
FAX (49) 71-31-67-2340

1150 East Cheyenne Mtn. Blvd.
Colorado Springs, CO 80906
TEL 1(719) 576-3300
FAX 1(719) 540-1759

Biometrics/Imaging/Hi-Rel MPU/ High Speed Converters/RF Data- com

Avenue de Rochepleine
BP 123
38521 Saint-Egreve Cedex, France
TEL (33) 4-76-58-30-00
FAX (33) 4-76-58-34-80

e-mail

literature@atmel.com

Web Site

<http://www.atmel.com>

Disclaimer: Atmel Corporation makes no warranty for the use of its products, other than those expressly contained in the Company's standard warranty which is detailed in Atmel's Terms and Conditions located on the Company's web site. The Company assumes no responsibility for any errors which may appear in this document, reserves the right to change devices or specifications detailed herein at any time without notice, and does not make any commitment to update the information contained herein. No licenses to patents or other intellectual property of Atmel are granted by the Company in connection with the sale of Atmel products, expressly or by implication. Atmel's products are not authorized for use as critical components in life support devices or systems.

© Atmel Corporation 2003. All rights reserved. Atmel® and combinations thereof are the trademarks of Atmel Corporation or its subsidiaries. Other terms and product names may be the trademarks of others.



Printed on recycled paper.