

Digital code output type


Description

FUJI AC series rotary switches offer a wide choice of output codes. They feature sliding Au-flashed contacts for high contact reliability. Inhibitor and parity check circuits guard against switch malfunctions caused by error signals. With only seven connections to make, these switches are an economical solution to multiposition switching needs.

Features

- Au-flashed contacts for high contact reliability.

- The protection of operator section meets the IP65 (IEC), so these switches can be used in oil-splash environments, such as on machine tool control panels.
- A wide choice of output codes fits a broad range of applications. Available step angles are 15, 30, and 360°/26 (13.85°). Real binary code, complementary binary code, and real gray code are available.
- Switches are available with connectors or with lock rings for easy handling.
- Stopper screw positions are user selectable.

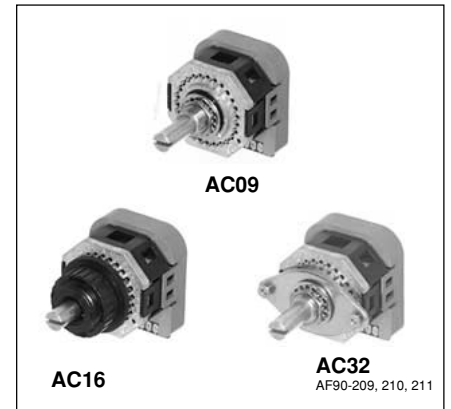

Ratings

Volts	Operational current (A) (resistive load)
50V AC	0.05
5V AC	0.5
25V DC	0.05
5V DC	0.25

Performance

Rated insulation voltage		60V
Operating temperature		-20 to +70°C
Humidity		45 to 85%RH (non condensation)
Service life	Mechanical	50,000 operations
	Electrical	50,000 operations
Dielectric strength	Between terminals	250V AC, 1 minute
	Between terminals and ground	1500V AC, 1 minute
Insulation resistance	Between terminals	500MΩ or more
	Between terminals and ground	5,000MΩ or more
Degree of protection (operator section)		IP65 (IEC)

Type number nomenclature

AC 09 – C Z 0 / 25 L1 E A01 / 0007

Basic type

Mounting

09: M9 nut
16: M16 adapter
32: Adapter
(32mm mounting pitch)

Type of code

R: Real binary code
C: Complementary binary code
G: Real gray code

Angle of step

Angle	Setting position
X: 30°	0 to 11
W: 360°/13 (27.69°)	0 to 12
Y: 15°	0 to 23
Z: 360°/26 (13.85°)	0 to 25

Start position

Available step angle
0 to 11: 30°
0 to 12: 360°/13 (27.69°)
0 to 23: 15°
0 to 25: 360°/26 (13.85°)

End position

Available step angle
0 to 11: 30°
0 to 12: 360°/13 (27.69°)
0 to 23: 15°
0 to 25: 360°/26 (13.85°)

With or without lock ring

Blank: Without lock ring
0007: With lock ring
0009: With adhesive lock ring

With or without connector

Blank: 8-terminal, without connector
A01: 8-terminal, with right-angle connector
A02: 8-terminal, with straight connector
B00: 7-terminal, without connector
B01: 7-terminal, with right-angle connector
B02: 7-terminal, with straight connector

With or without stopper screw

Blank: With stopper screw
E: Without stopper screw

Length of shaft (mm)

	AC09	AC16	AC32
L1:	16	—	14.5
L2:	18	—	16.5
L3:	20	—	18.5
L4:	22	19.5	20.5

Note: When shorter action than the maximum range of switch action is used, stopper screws are used. However, stopper screws are not used if the maximum action range is used when either 15° (symbol Y) or 360°/26 (symbol Z) is specified.

Rotary Switches

AC09, 16 and 32

• M9 nut mounting

Angle of step	Connector	Lock ring	Type*1 *2 *3		
			Real binary code	Complementary binary code	Real gray code
30°	Without connector	Without lock ring	AC09-RX□□()■	AC09-CX□□()■	AC09-GX□□()■
		With lock ring	AC09-RX□□()■/0007	AC09-CX□□()■/0007	AC09-GX□□()■/0007
		With adhesive lock ring	AC09-RX□□()■/0009	AC09-CX□□()■/0009	AC09-GX□□()■/0009
30°	With right angle connector	Without lock ring	AC09-RX□□()■01	AC09-CX□□()■01	AC09-GX□□()■01
		With lock ring	AC09-RX□□()■01/0007	AC09-CX□□()■01/0007	AC09-GX□□()■01/0007
		With adhesive lock ring	AC09-RX□□()■01/0009	AC09-CX□□()■01/0009	AC09-GX□□()■01/0009
30°	With straight connector	Without lock ring	AC09-RX□□()■02	AC09-CX□□()■02	AC09-GX□□()■02
		With lock ring	AC09-RX□□()■02/0007	AC09-CX□□()■02/0007	AC09-GX□□()■02/0007
		With adhesive lock ring	AC09-RX□□()■02/0009	AC09-CX□□()■02/0009	AC09-GX□□()■02/0009
360°/13 (27.69°)	Without connector	Without lock ring	AC09-RW□□()■	AC09-CW□□()■	
		With lock ring	AC09-RW□□()■/0007	AC09-CW□□()■/0007	
		With adhesive lock ring	AC09-RW□□()■/0009	AC09-CW□□()■/0009	
360°/13 (27.69°)	With right angle connector	Without lock ring	AC09-RW□□()■01	AC09-CW□□()■01	
		With lock ring	AC09-RW□□()■01/0007	AC09-CW□□()■01/0007	
		With adhesive lock ring	AC09-RW□□()■01/0009	AC09-CW□□()■01/0009	
360°/13 (27.69°)	With straight connector	Without lock ring	AC09-RW□□()■02	AC09-CW□□()■02	
		With lock ring	AC09-RW□□()■02/0007	AC09-CW□□()■02/0007	
		With adhesive lock ring	AC09-RW□□()■02/0009	AC09-CW□□()■02/0009	
15°	Without connector	Without lock ring	AC09-RY□□()■	AC09-CY□□()■	AC09-GY□□()■
		With lock ring	AC09-RY□□()■/0007	AC09-CY□□()■/0007	AC09-GY□□()■/0007
		With adhesive lock ring	AC09-RY□□()■/0009	AC09-CY□□()■/0009	AC09-GY□□()■/0009
15°	With right angle connector	Without lock ring	AC09-RY□□()■01	AC09-CY□□()■01	AC09-GY□□()■01
		With lock ring	AC09-RY□□()■01/0007	AC09-CY□□()■01/0007	AC09-GY□□()■01/0007
		With adhesive lock ring	AC09-RY□□()■01/0009	AC09-CY□□()■01/0009	AC09-GY□□()■01/0009
15°	With straight connector	Without lock ring	AC09-RY□□()■02	AC09-CY□□()■02	AC09-GY□□()■02
		With lock ring	AC09-RY□□()■02/0007	AC09-CY□□()■02/0007	AC09-GY□□()■02/0007
		With adhesive lock ring	AC09-RY□□()■02/0009	AC09-CY□□()■02/0009	AC09-GY□□()■02/0009
360°/26 (13.85°)	Without connector	Without lock ring	AC09-RZ□□()■	AC09-CZ□□()■	AC09-GZ□□()■
		With lock ring	AC09-RZ□□()■/0007	AC09-CZ□□()■/0007	AC09-GZ□□()■/0007
		With adhesive lock ring	AC09-RZ□□()■/0009	AC09-CZ□□()■/0009	AC09-GZ□□()■/0009
360°/26 (13.85°)	With right angle connector	Without lock ring	AC09-RZ□□()■01	AC09-CZ□□()■01	AC09-GZ□□()■01
		With lock ring	AC09-RZ□□()■01/0007	AC09-CZ□□()■01/0007	AC09-GZ□□()■01/0007
		With adhesive lock ring	AC09-RZ□□()■01/0009	AC09-CZ□□()■01/0009	AC09-GZ□□()■01/0009
360°/26 (13.85°)	With straight connector	Without lock ring	AC09-RZ□□()■02	AC09-CZ□□()■02	AC09-GZ□□()■02
		With lock ring	AC09-RZ□□()■02/0007	AC09-CZ□□()■02/0007	AC09-GZ□□()■02/0007
		With adhesive lock ring	AC09-RZ□□()■02/0009	AC09-CZ□□()■02/0009	AC09-GZ□□()■02/0009

Notes:

*1 Replace the □□ marks by the Start and End positions

Step angle	30°	360°/13	15°	360°/26
Start and End positions	0 to 11	0 to 12	0 to 23	0 to 25

*2 Replace the () mark by the shaft length code

L1: 16mm L2: 18mm L3: 20mm L4: 22mm

*3 Replace the ■ mark by the connector

Blank: 8-terminal, without connector
 A01: 8-terminal, with right angle connector
 A02: 8-terminal, with straight connector
 B00: 7-terminal, without connector
 B01: 7-terminal, with right angle connector
 B02: 7-terminal, with straight connector

• M16 adapter mounting

Angle of step	Connector	Type*1 *2		
		Real binary code	Complementary binary code	Real gray code
30°	Without connector	AC16-RX□□L4■	AC16-CX□□L4■	AC16-GX□□L4■
	With right angle connector	AC16-RX□□L4■01	AC16-CX□□L4■01	AC16-GX□□L4■01
	With straight connector	AC16-RX□□L4■02	AC16-CX□□L4■02	AC16-GX□□L4■02
360°/13 (27.69°)	Without connector	AC16-RW□□L4■	AC16-CW□□L4■	
	With right angle connector	AC16-RW□□L4■01	AC16-CW□□L4■01	
	With straight connector	AC16-RW□□L4■02	AC16-CW□□L4■02	
15°	Without connector	AC16-RY□□L4■	AC16-CY□□L4■	AC16-GY□□L4■
	With right angle connector	AC16-RY□□L4■01	AC16-CY□□L4■01	AC16-GY□□L4■01
	With straight connector	AC16-RY□□L4■02	AC16-CY□□L4■02	AC16-GY□□L4■02
360°/26 (13.85°)	Without connector	AC16-RZ□□L4■	AC16-CZ□□L4■	AC16-GZ□□L4■
	With right angle connector	AC16-RZ□□L4■01	AC16-CZ□□L4■01	AC16-GZ□□L4■01
	With straight connector	AC16-RZ□□L4■02	AC16-CZ□□L4■02	AC16-GZ□□L4■02

Notes:

*1 Replace the □□ marks by the Start and End positions

Step angle	30°	360°/13	15°	360°/26
Start and End positions	0 to 11	0 to 12	0 to 23	0 to 25

*2 Replace the ■ mark by the connector

Blank: 8-terminal, without connector
A01: 8-terminal, with right angle connector
A02: 8-terminal, with straight connector
B00: 7-terminal, without connector
B01: 7-terminal, with right angle connector
B02: 7-terminal, with straight connector

• Adaptor mounting (32mm mounting pitch)

Angle of step	Connector	Type*1 *2 *3		
		Real binary code	Complementary binary code	Real gray code
30°	Without connector	AC32-RX□□()■	AC32-CX□□()■	AC32-GX□□()■
	With right angle connector	AC32-RX□□()■01	AC32-CX□□()■01	AC32-GX□□()■01
	With straight connector	AC32-RX□□()■02	AC32-CX□□()■02	AC32-GX□□()■02
360°/13 (27.69°)	Without connector	AC32-RW□□()■	AC32-CW□□()■	
	With right angle connector	AC32-RW□□()■01	AC32-CW□□()■01	
	With straight connector	AC32-RW□□()■02	AC32-CW□□()■02	
15°	Without connector	AC32-RY□□()■	AC32-CY□□()■	AC32-GY□□()■
	With right angle connector	AC32-RY□□()■01	AC32-CY□□()■01	AC32-GY□□()■01
	With straight connector	AC32-RY□□()■02	AC32-CY□□()■02	AC32-GY□□()■02
360°/26 (13.85°)	Without connector	AC32-RZ□□()■	AC32-CZ□□()■	AC32-GZ□□()■
	With right angle connector	AC32-RZ□□()■01	AC32-CZ□□()■01	AC32-GZ□□()■01
	With straight connector	AC32-RZ□□()■02	AC32-CZ□□()■02	AC32-GZ□□()■02

Notes:

*1 Replace the □□ marks by the Start and End positions

Step angle	30°	360°/13	15°	360°/26
Start and End positions	0 to 11	0 to 12	0 to 23	0 to 25

*2 Replace the () mark by the shaft length
L1: 14.5mm L2: 16.5mm L3: 18.5mm L4: 20.5mm

*3 Replace the ■ mark by the connector


Blank: 8-terminal, without connector
A01: 8-terminal, with right angle connector
A02: 8-terminal, with straight connector
B00: 7-terminal, without connector
B01: 7-terminal, with right angle connector
B02: 7-terminal, with straight connector

■ Accessories

Lead wire with connector (8-terminal)




Length of lead wire (m)	Type	Mass (g)
0.5	ACX011-805	11
1.0 (Standard)	ACX011-810	19
2.0	ACX011-820	33

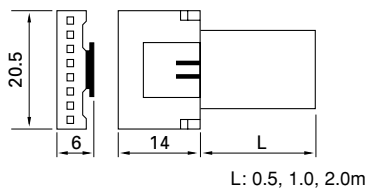



Lock ring




	Type	Mass (g)
Lock ring (inserted)	ACX001	2
Lock ring (sealed)	ACX001A	5

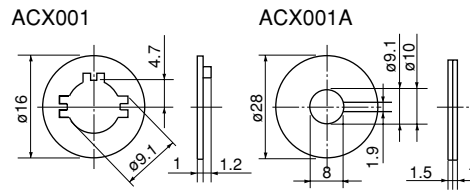



■ Dimensions, mm AC09

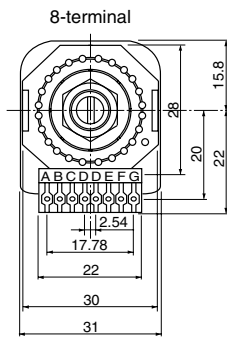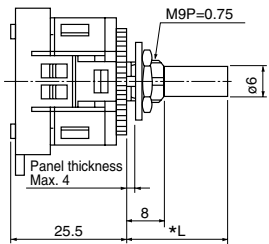


Panel cutting

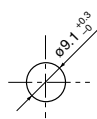


AC09 (with connector)

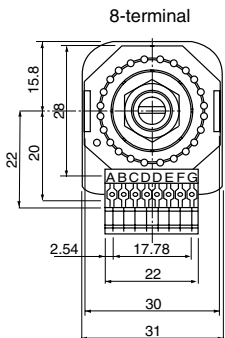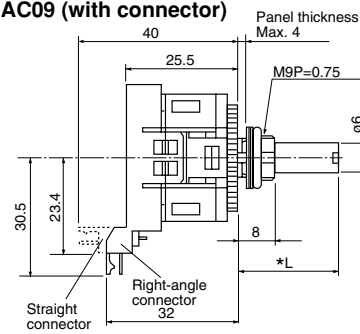

Panel cutting

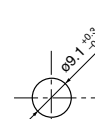


In case of using lock ring (AC09-□0007)

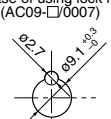


Panel thickness 1.2 to 3.2


AC16

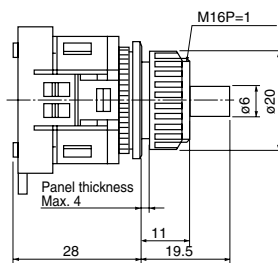


Mass: 47g

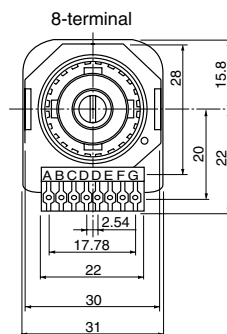


Panel cutting

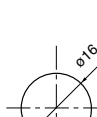


AC32

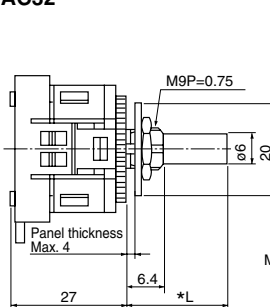

Shaft length *	L1	L2	L3	L4
	14.5	16.5	18.5	20.5
Mass (g)	47	48	49	50

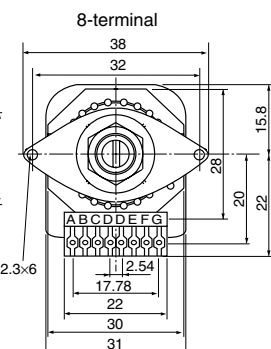


Panel cutting

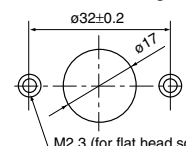

Rotary Switches AC09, 16 and 32

■ Installation

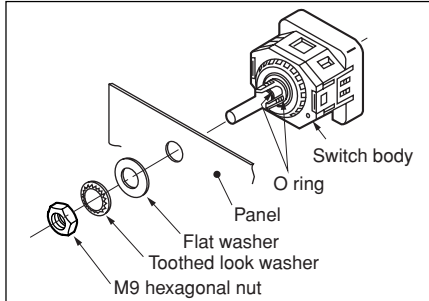


AC09

Pass the switch body through the hole from the back of the panel, and secure it by tightening the hexagonal nut with a flat washer and a toothed lock washer.


The recommended tightening torque for the hexagonal nut is 1.5 to 2N·m.

Insert the lock ring (ACX001) between the panel and the flat washer, and the adhesive lock ring (ACX001A) between the switch body and the panel.

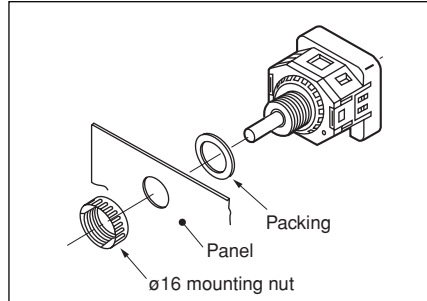

AC16

Pass the switch body with a bezel through the hole from the back of the panel, and secure it with a $\phi 16$ mounting nut. The recommended tightening torque for the nut is 0.6 to 1N·m.

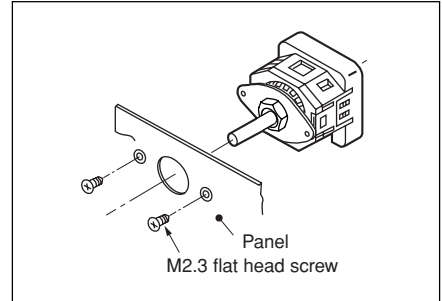

AC32

Pass the switch body through the hole from the back of the panel, and secure it with two flat head screws from the face of the panel. The recommended tightening torque for the flat head screws is 0.3 to 0.5N·m.


■ Notes on use

1. Connecting wires

Note the following points when soldering:

- The power of the soldering iron must not be over 30W.
- Use solder with resin flux core.
- Complete soldering within 5 seconds if using a 30W soldering iron, or within 10 seconds if using a 20W soldering iron.

2. Note on the case linkage

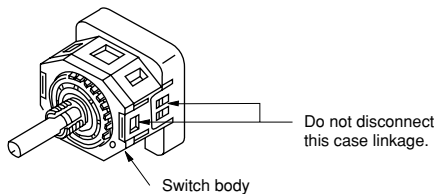


3. Number of stopper screws shipped

- AC09 and AC32
 - Step angle: 30° (symbol X)
Positions 0/11 (0 to 11): one screw. User-selectable start and stop positions: two screws (one for start position, one for end position).
 - Step angle: 15° (symbol Y)
Positions 0/22 (0 to 22): one screw. User-selectable start and stop positions: two screws (one for start position, one for end position).
 - Step angle: 360°/26 (symbol Z)
Positions 0/24 (0 to 24): one screw. User-selectable start and stop positions: two screws (one for start position, one for end position).
- AC16
Customers can specify the stopper screw positions. The switch is then shipped with stopper screws already in the specified positions.


4. Stopper screw positions

Insert stopper screws into the switch body holes marked with letters, as shown in the insertion example on the right. These tables below show that the start position stopper screw is inserted in the hole on the left of the position setting and the end positions stopper screw is inserted in the hole on the right.

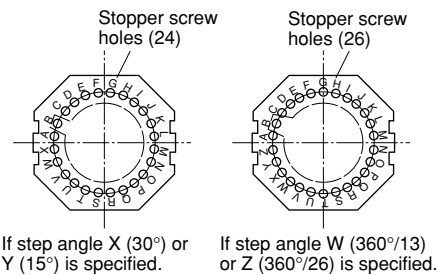


5. Installing a stopper screw

The maximum tightening torque for a stopper screw is 0.1N·m. Screw the stopper screw into position until it hits the body frame rib. Do not overtighten the screw.

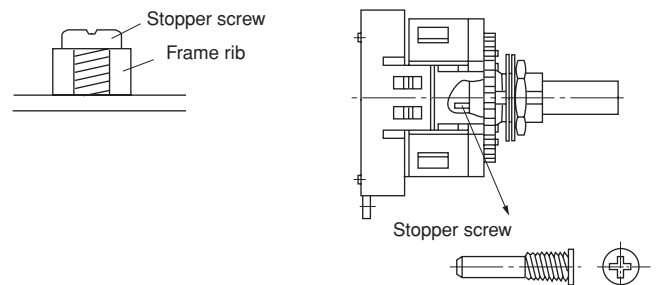


Insertion example 1

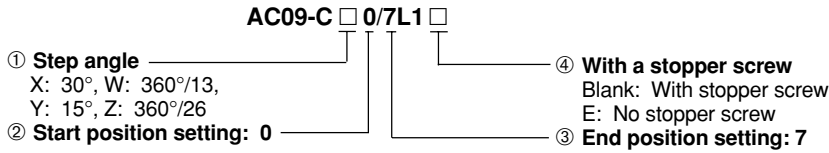


• If symbol ① (step angle) is X-----type AC09-CX0/7L1:

Insert the start side stopper screw in hole A and the end side screw in hole Q.

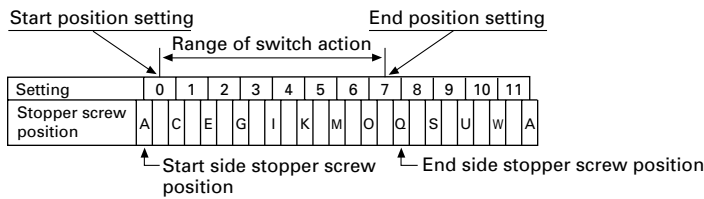


• If symbol ① (step angle) is W-----type AC09-CW0/7L1:

Insert the start side stopper screw in hole A and the end side screw in hole Q.

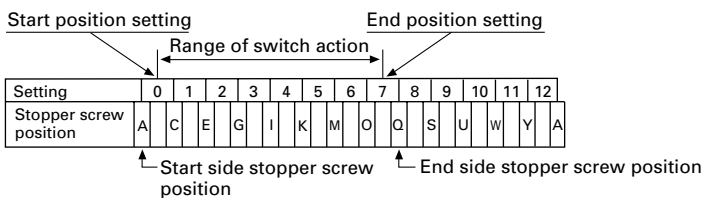

• If symbol ① (step angle) is Y-----type AC09-CY0/7L1:


Insert the start side stopper screw in hole A and the end side screw in hole J.

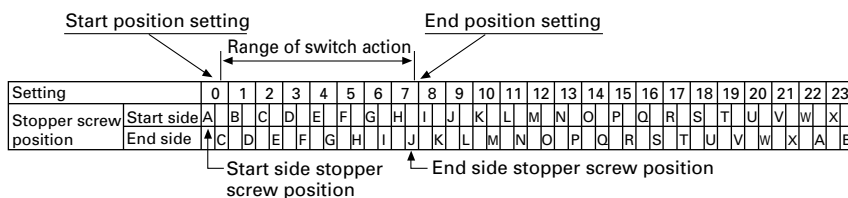

Notes: 1. If the range of action is designated as 0/22 (0 to 22), insert a stopper screw into hole A only.
2. If the range of action is designated as 0/23 (0 to 23), no stopper screws are inserted (symbol ④ is E).

• If symbol ① (step angle) is Z-----type AC09-CZ0/7L1:

Insert the start side stopper screw in hole A and the end side screw in hole J.

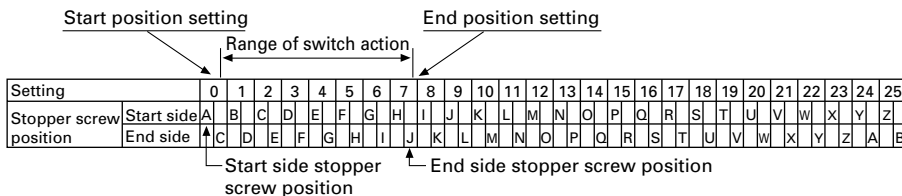

Notes: 1. If the range of action is designated as 0/24 (0 to 24), insert a stopper screw in hole A only.
2. If the range of action is designated as 0/25 (0 to 25), no stopper screws are inserted (symbol ④ is E).

Insertion example 2

