

Master-Slave Flip-Flop

Master slave construction renders the MC1670 relatively insensitive to the shape of the clock waveform, since only the voltage levels at the clock inputs control the transfer of information from data input (D) to output.

When both clock inputs (C1 and C2) are in the low state, the data input affects only the "Master" portion of the flip-flop. The data present in the "Master" is transferred to the "Slave" when clock inputs (C1 "OR" C2) are taken from a low to a high level. In other words, the output state of the flip-flop changes on the positive transition of the clock pulse.

While either C1 "OR" C2 is in the high state, the "Master" (and data input) is disabled.

Asynchronous Set (S) and Reset (R) override Clock (C) and Data (D) inputs.

Power Dissipation = 220 mW typ (No Load)

fTog = 350 MHz typ

TRUTH TABLE

R	S	D	C	Q _{n+1}
L	H	X	X	H
H	L	X	X	L
H	H	X	X	N.D.
L	L	L	L	Q _n
L	L	L	H	L
L	L	L	L	Q _n
L	L	H	L	Q _n
L	L	H	H	H
L	L	H	L	Q _n

ND = Not Defined
C = C1 + C2

ELECTRICAL CHARACTERISTICS


Characteristic	Symbol	-30°C		+25°C		+85°C		Unit
		Min	Max	Min	Max	Min	Max	
Power Supply Drain Current	I _E	—	—	—	48	—	—	mAdc
Input Current	I _{inH}	—	—	—	550	—	—	μAdc
Set, Reset		—	—	—	250	—	—	
Clock		—	—	—	270	—	—	
Data		—	—	—	270	—	—	
Switching Times								ns
Propagation Delay	t _{pd}	1.0	2.7	1.1	2.5	1.1	2.9	
Rise Time (10% to 90%)	t ⁺	0.9	2.7	1.0	2.5	1.0	2.9	
Fall Time (10% to 90%)	t ⁻	0.5	2.1	0.6	1.9	0.6	2.3	
Setup Time	t _{S"1"} t _{S"0"}	—	—	0.4 0.5	— —	— —	— —	
Hold Time	t _{H"1"} t _{H"0"}	—	—	0.3 0.5	— —	— —	— —	
Toggle Frequency	f _{Tog}	270	—	300	—	270	—	MHz

MC1670



L SUFFIX
CERAMIC PACKAGE
CASE 620-10

LOGIC DIAGRAM

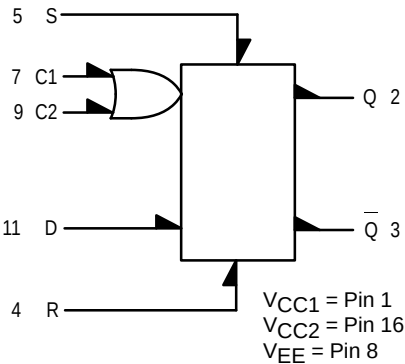

PIN ASSIGNMENT


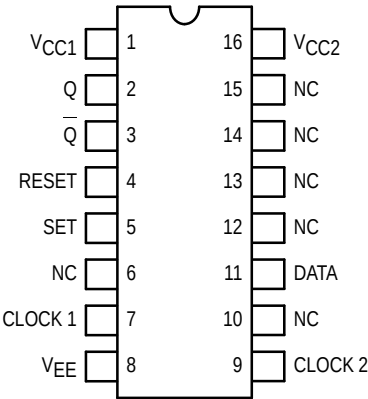


FIGURE 1 — TOGGLE FREQUENCY WAVEFORMS

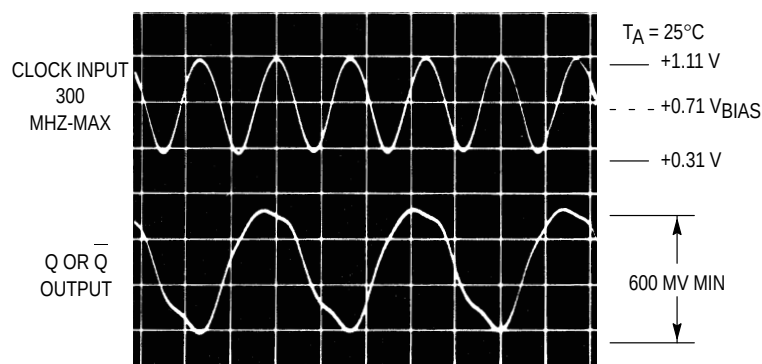

The maximum toggle frequency of the MC1670 has been exceeded when either:

1. The output peak-to-peak voltage swing falls below 600 millivolts,
OR
2. The device ceases to toggle (divide by two).

FIGURE 2 — MAXIMUM TOGGLE FREQUENCY (TYPICAL)


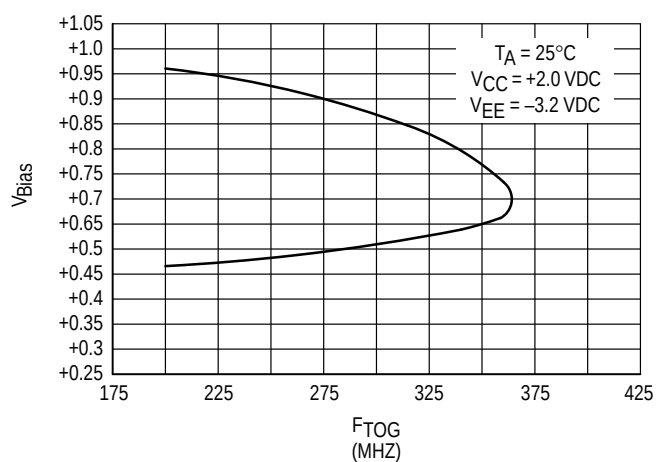


Figure 2 illustrates the variation in toggle frequency with the dc offset voltage (V_{Bias}) of the input clock signal. Figures 4 and 5 illustrate minimum clock pulse width recommended for reliable operation of the MC1670.

FIGURE 3 — TYPICAL MAXIMUM TOGGLE FREQUENCY versus TEMPERATURE

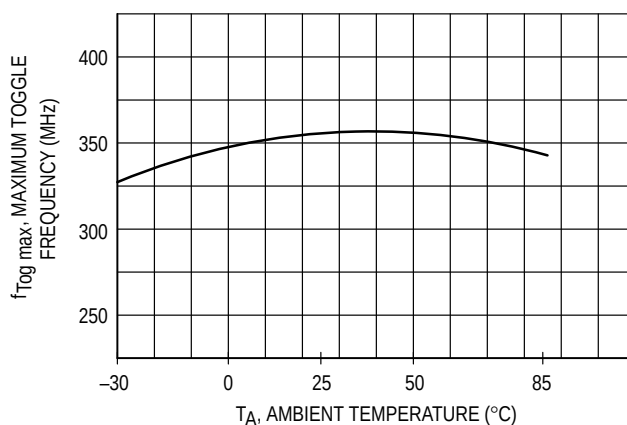

Temperature	-30°C	+25°C	+85°C
V_{Bias}	+0.66 Vdc	+0.71 Vdc	+0.765 Vdc

Note: All power supply and logic levels are shown shifted 2.0 volts positive.

FIGURE 4 — MINIMUM “DOWN TIME” TO CLOCK
OUTPUT LOAD = 50 Ω



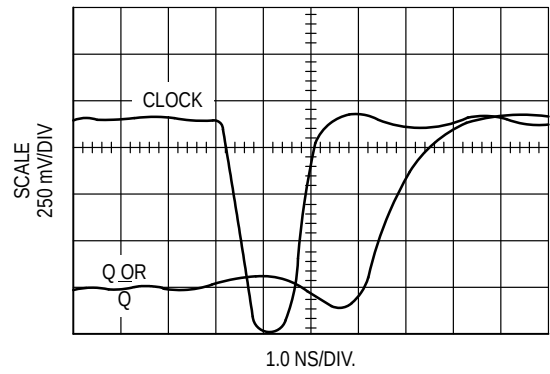


FIGURE 5 — MINIMUM “UP TIME” TO CLOCK
OUTPUT LOAD = 50 Ω

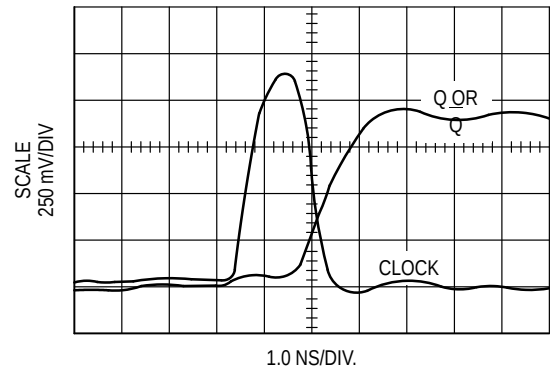

OUTLINE DIMENSIONS

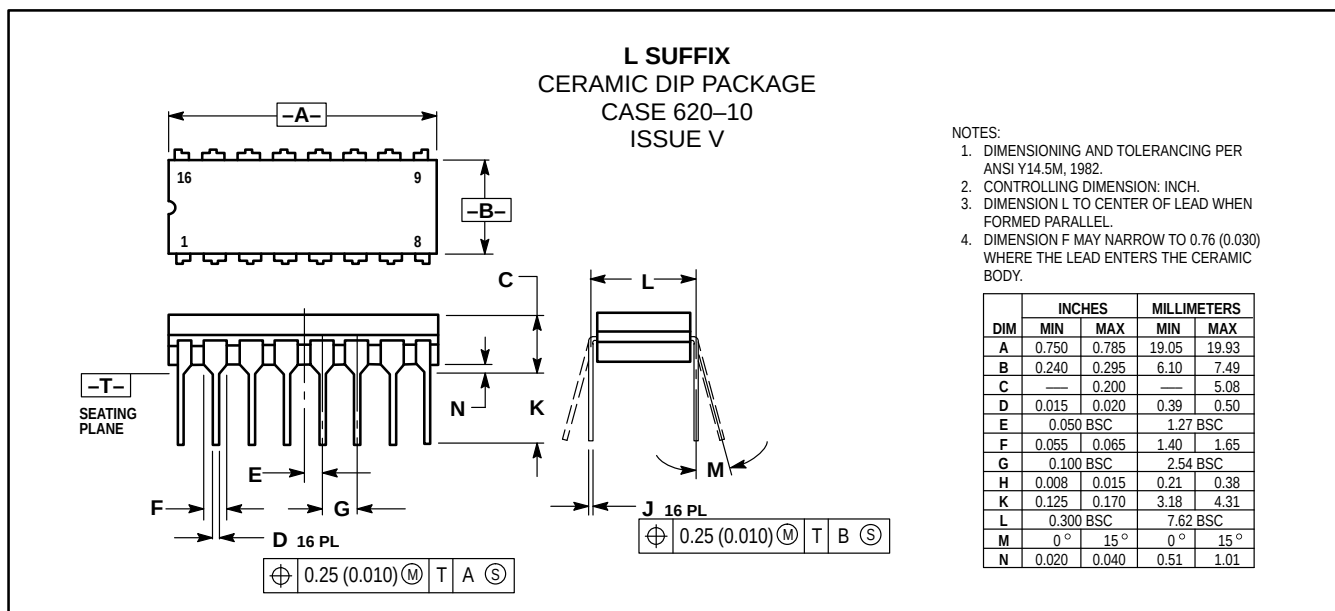

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part. Motorola and  are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

How to reach us:

USA/EUROPE/Locations Not Listed: Motorola Literature Distribution;
P.O. Box 5405, Denver, Colorado 80217. 1-800-441-2447

Mfax™: RMFAX0@email.sps.mot.com – TOUCHTONE 602-244-6609
INTERNET: http://Design-NET.com

JAPAN: Nippon Motorola Ltd.; Tatsumi-SPD-JLDC, 6F Seibu-Butsuryu-Center,
3-14-2 Tatsumi Koto-Ku, Tokyo 135, Japan. 03-81-3521-8315

ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd.; 8B Tai Ping Industrial Park,
51 Ting Kok Road, Tai Po, N.T., Hong Kong. 852-26629298

