

# **RLT850-100GS**


# **TECHNICAL DATA**

# **High Power Infrared Laser Diode**

#### Features

- Lasing Mode Structure: single mode
- Peak Wavelength : typ. 852 nm
- Optical Output Power: 100 W
- Package: 9 mm

# **Electrical Connection**

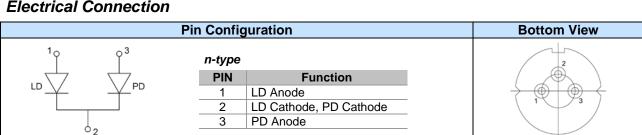

# Absolute Maximum Ratings (T<sub>c</sub>=25°C)

Item	Symbol	Value	Unit
CW Output Power	Po		mW
LD Reverse Voltage	V <sub>R(LD)</sub>		V
PD Reverse Voltage	V <sub>R(PD)</sub>		V
Operating Case Temperature	Tc	-20 +50	°C
Storage Temperature	T <sub>stg</sub>	-40 +80	°C

# Specifications (T<sub>c</sub>=25°C)

Item	Symbol	Min.	Тур.	Max.	Unit		
Optical Specification							
CW Output Power	Po	-	100	-	mW		
Peak Wavelength	λ <sub>P</sub>	847	852	857	nm		
Spectral Width (FWHM)	Δλ	-	0.5	2	nm		
FWHM Beam Divergence	θ∥	-	8	10	deg		
	θ⊥	-	28	30	deg		
Emitting Aperature	WxH		5 x 1		μm		
Lifetime		100000	-	-	hour		
Electrical Specification							
Threshold Current	l <sub>th</sub>	-	20	40	mA		
Operating Current	I <sub>op</sub>	-	120	170	mA		
Slope Efficiency	η	0.9	1.0	-	W/A		
Operating Voltage	V <sub>op</sub>	-	1.9	2.2	V		
Monitor Current	l <sub>m</sub>				mA		

The above specifications are for reference purpose only and subjected to change without prior notice.






ATTENTION RVE PRECAUTIONS

CTROSTATIC SENSITIVE DEVICES




# Package Dimensons

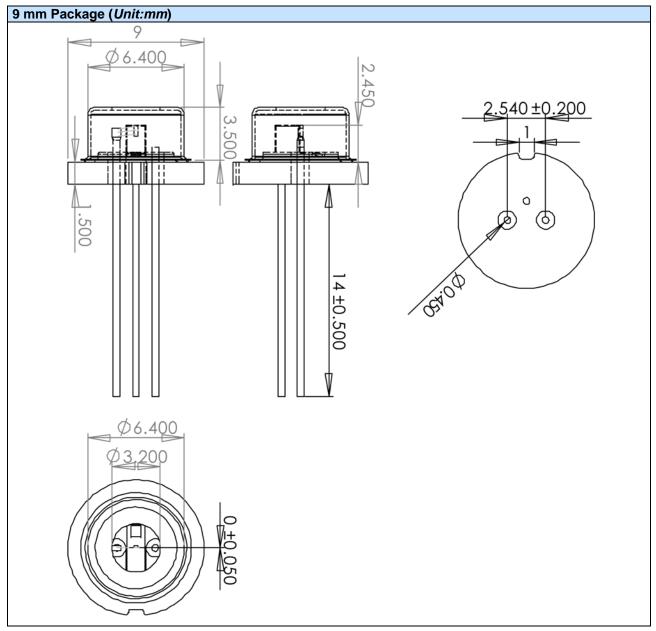



# **Typical Performance Curves**

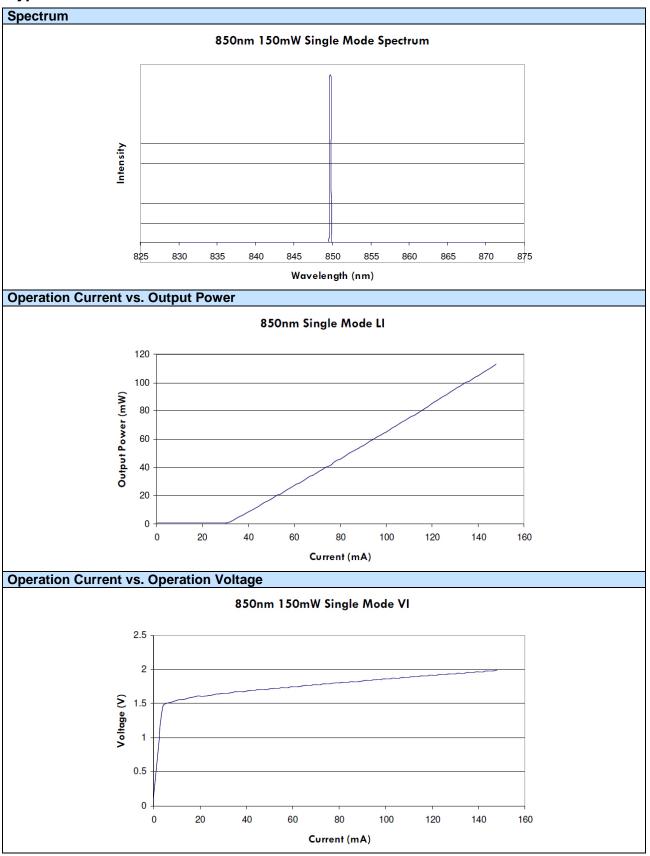



#### Safety of Laser light

- Laser Light can damage the human eyes and skin. Do not expose the eye or skin directly to any laser light and/or through optical lens. When handling the LDs, wear appropriate safety glasses to prevent laser light, even any reflections from entering to the eye. Focused laser beam through optical instruments will increase the chance of eye hazard.
- WARNING: Laser diode is emitting invisible light



#### Cautions

#### 1. Operating method

- This LD shall change its forward voltage requirement and optical output power according to temperature change. Also, the LD will require more operation current to maintain same output power as it degrades.
- Confirm that electrical spike current generated by switching on and off does not exceed the
  maximum operating current level specified herein above as absolute maximum rating. Also,
  employ appropriate countermeasures to reduce chattering and/or overshooting in the circuit.

#### 2. Static Electricity

• Static electricity or electrical surges will reduce and degrade the reliability of the LDs. It is recommended to use a wrist trap or anti-electrostatic glove when handling the product.

#### 3. Absolute Maximum Rating

• Active layer of LDs shall have high current density and generate high electric field during its operation. In order to prevent excessive damage, the LD must be operated strictly below absolute maximum rating.