

## T-1 3/4(5mm) BLINKING LED LAMP

Part Number: WP56BHD

**Bright Red** 

#### **Features**


- T-1 3/4 PACKAGE.
- WITH BUILT BLINKING IC.
- OPERATION VOLTAGE FROM 3.5V TO 14V.
- BLINKING FREQUENCY FROM 3.0Hz TO 1.5Hz.
- RoHs COMPLIANT.

### Description

The Bright Red source color devices are made with Gallium Phosphide Red Light Emitting Diode.

### **Package Dimensions**



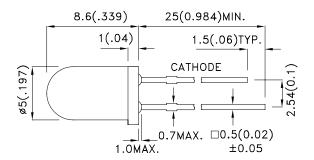

Notes:

1.All Dimensios are millimeters(inches).

2.Tolerance is +/-0.25(0.01")unless otherwise noted.

3.Lead specing is measured where the leads emerge from the package. 4.Specifications are subject to change without notice.





SPEC NO: DSAF2693 **REV NO: V.2 DATE: MAY/18/2007** PAGE: 1 OF 6 APPROVED: WYNEC **CHECKED: Allen Liu** DRAWN: Y.L.LI ERP: 1101005621

## **Selection Guide**

Part No.	Dice	Lens Type	lv (n V=	,	Viewing Angle [1]
		<i>,</i> .	Min.	Тур.	201/2
WP56BHD	Bright Red (GaP)	RED DIFFUSED	1.8	5	60°

# Electrical / Optical Characteristics at TA=25°C

Symbol	Parameter	Device	Min.	Тур.	Max.	Units	Test Conditions
λpeak	Peak Wavelength	Bright Red		700		nm	
λD	Dominant Wavelength	Bright Red		660		nm	
Δλ1/2	Spectral Line Half-width	Bright Red		45		nm	
lF	Forward Current	Bright Red	8	22		mA	Min:VF=3.5V Typ:VF=5V
Ison	Supply Current	Bright Red		8		mA	VF=3.5V
Ison	Supply Current	Bright Red		44		mA	VF=14V
f	Blink Frequency	Bright Red	1.5		3	Hz	VF=3.5V~14V


### Absolute Maximum Ratings at TA=25°C

/ too oratio maximum ratings at 171 20 0					
Parameter Bright Red		Units			
Power dissipation	310	mW			
Forward Voltage	14	V			
Reverse Voltage	0.5	V			
Operating Temperature	-40°C To +70°C	•			
Storage Temperature	-40°C To +85°C				
Lead Solder Temperature [1]	260°C For 3 Seconds				
Lead Solder Temperature [2]	260°C For 5 Seconds				


- 2mm below package base.
   5mm below package base.


SPEC NO: DSAF2693 REV NO: V.2 DATE: MAY/18/2007 PAGE: 2 OF 6 APPROVED: WYNEC **CHECKED: Allen Liu** DRAWN: Y.L.LI ERP: 1101005621


<sup>1.</sup>  $\theta$ 1/2 is the angle from optical centerline where the luminous intensity is 1/2 the optical centerline value.

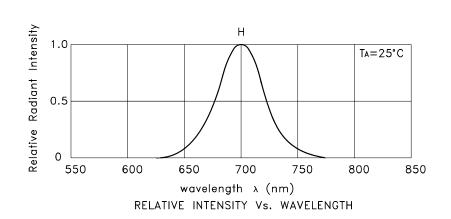

Bright Red WP56BHD

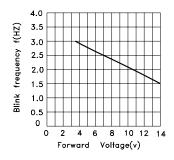


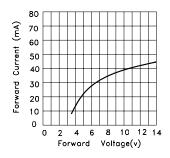

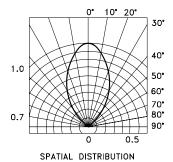

 SPEC NO: DSAF2693
 REV NO: V.2
 DATE: MAY/18/2007
 PAGE: 3 OF 6


 APPROVED: WYNEC
 CHECKED: Allen Liu
 DRAWN: Y.L.LI
 ERP: 1101005621

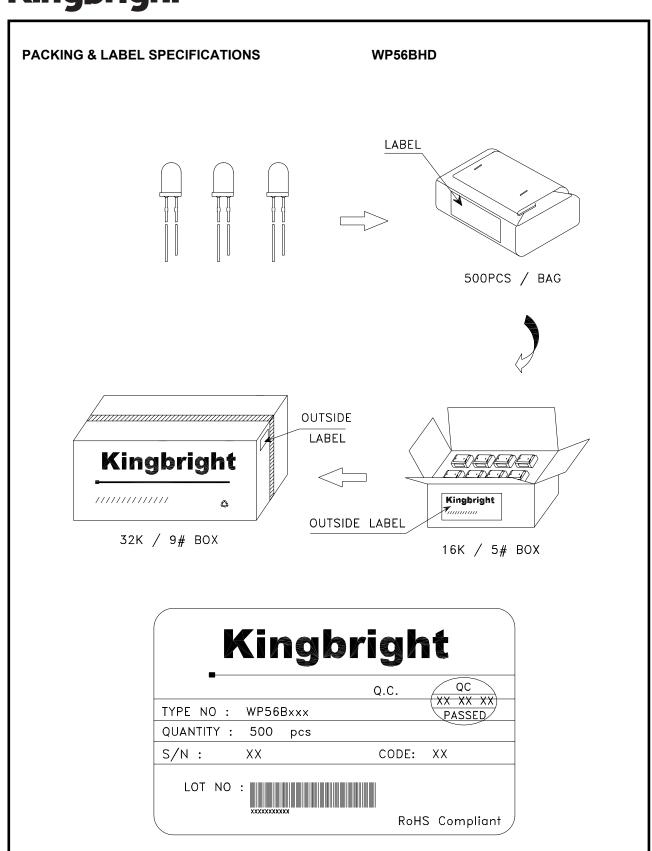

SPEC NO: DSAF2693 APPROVED: WYNEC REV NO: V.2 CHECKED: Allen Liu DATE: MAY/18/2007 DRAWN: Y.L.LI PAGE: 4 OF 6 ERP: 1101005621


### LED MOUNTING METHOD

1. The lead pitch of the LED must match the pitch of the mounting holes on the PCB during component placement. Lead—forming may be required to insure the lead pitch matches the hole pitch. Refer to the figure below for proper lead forming procedures.

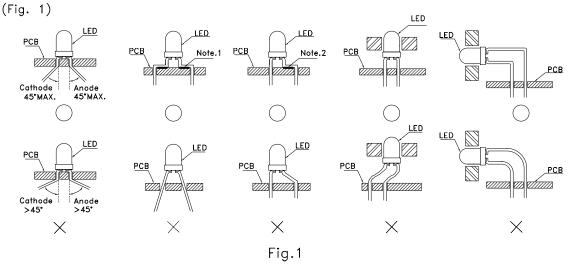


" $\bigcirc$ " Correct mounting method " $\times$ " Incorrect mounting method Note 1-2: Do not route PCB trace in the contact area between the leadframe and the PCB to prevent short-circuits.

2. When soldering wire to the LED, use individual heat—shrink tubing to insulate the exposed leads to prevent accidental contact short—circuit. (Fig. 2)



rig. Z


3. Use stand—offs (Fig. 3) or spacers (Fig. 4) to securely position the LED above the PCB.

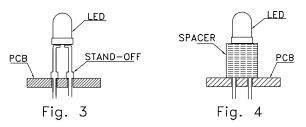


SPEC NO: DSAF2693 APPROVED: WYNEC REV NO: V.2 CHECKED: Allen Liu DATE: MAY/18/2007 DRAWN: Y.L.LI PAGE: 5 OF 6 ERP: 1101005621

### LEAD FORMING PROCEDURES


1. Maintain a minimum of 2mm clearance between the base of the LED lens and the first lead bend. (Fig. 5 and 6)

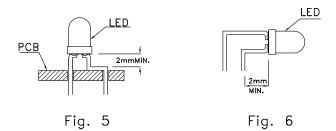

- 2. Lead forming or bending must be performed before soldering, never during or after Soldering.
- 3. Do not stress the LED lens during lead—forming in order to fractures in the lens epoxy and damage the internal structures.
- 4. During lead forming, use tools or jigs to hold the leads securely so that the bending force will not be transmitted to the LED lens and its internal structures. Do not perform lead forming once the component has been mounted onto the PCB. (Fig. 7)
- 5. Do not bend the leads more than twice. (Fig. 8)

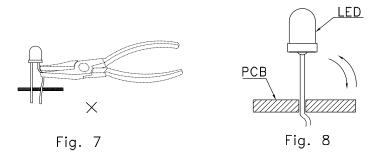

6. After soldering or other high—temperature assembly, allow the LED to cool down to 50°C before applying outside force (Fig. 9). In general, avoid placing excess force on the LED to avoid damage. For any questions please consult with Kingbright representative for proper handling procedures.

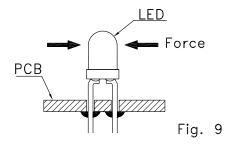

SPEC NO: DSAF2693 REV NO: V.2

APPROVED: WYNEC CHECKED: Allen Liu

DATE: MAY/18/2007 DRAWN: Y.L.LI PAGE: 6 OF 6 ERP: 1101005621