

The RF Line


110-Channel (750 MHz) CATV Amplifier

MHW7222A

The MHW7222A is designed specifically for up to 750 MHz CATV systems as amplifiers in trunk and line extender applications. This amplifier features ion-implanted, arsenic emitter transistors, an all gold metallization system and offers improved ruggedness and distortion performance.

- Specified for 110-Channel Performance
- Broadband Power Gain — @ $f = 40-750$ MHz
 $G_p = 22.3$ dB Typ @ 750 MHz
- Broadband Noise Figure
NF = 5.5 dB Typ
- All Gold Metallization

22 dB GAIN
750 MHz
110 CHANNEL
CATV AMPLIFIER

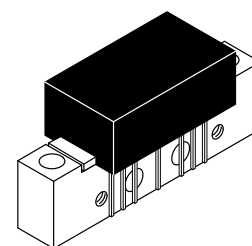

CASE 714Y-03, STYLE 1

ABSOLUTE MAXIMUM RATINGS

Rating	Symbol	Value	Unit
DC Supply Voltage	V_{CC}	+28	Vdc
RF Input Voltage (Single Tone)	V_{in}	+70	dBmV
Operating Case Temperature Range	T_C	-20 to +100	°C
Storage Temperature Range	T_{stg}	-40 to +100	°C

ELECTRICAL CHARACTERISTICS ($V_{CC} = 24$ Vdc, $T_C = +30$ °C, 75 Ω system unless otherwise noted)

Characteristic	Symbol	Min	Typ	Max	Unit
Frequency Range	BW	40	—	750	MHz
Power Gain $f = 50$ MHz $f = 750$ MHz	G_p	20.8 22	21.5 22.3	22.2 24	dB
Slope ($f = 40-750$ MHz)	S	0	1	2	—
Gain Flatness (Peak To Valley) ($f = 40-750$ MHz)	G_f	—	0.4	0.6	—
Input/Output Return Loss @ $f = 40$ MHz	IRL/ORL	20	24	—	dB
Derate Return Loss @ $f > 40$ MHz	RLD	—	—	0.008	dB/MHz
Composite Second Order ($V_{out} = +40$ dBmV/ch; 110 Channels) ($V_{out} = +44$ dBmV/ch; 77 Channels)	CSO ₁₁₀ CSO ₇₇	— —	-65 -65	-57 —	dB

(continued)

ELECTRICAL CHARACTERISTICS — continued

Characteristic	Symbol	Min	Typ	Max	Unit
Cross Modulation Distortion ($V_{out} = +40$ dBmV/ch, 110-Channel @ $F_m = 55.25$ MHz) ($V_{out} = +44$ dBmV/ch, 77-Channel @ $F_m = 55.25$ MHz)	XMD ₁₁₀ XMD ₇₇	—	-64 -60	-60 —	dBc
Composite Triple Beat ($V_{out} = +40$ dBmV/ch, 110-Channels, Worst Case) ($V_{out} = +44$ dBmV/ch, 77-Channels, Worst Case)	CTB ₁₁₀ CTB ₇₇	—	-63 -62	-60 —	dBc
Noise Figure $f = 50$ MHz $f = 750$ MHz	NF	—	3.6 5.5	5 7	dB
DC Current	I_{DC}	180	220	240	mA

PACKAGE DIMENSIONS

Q 2 PL
 $\text{Ø } 0.25 (0.010) \text{ (M) T F (M) A (M)}$

Y 2 PL
 $\text{Ø } 0.25 (0.010) \text{ (M) Z T A (M)}$

6-32UNC-2B 2 PL
 $\text{Ø } 0.25 (0.010) \text{ (M) Z T A (M)}$

D 7 PL
 $\text{Ø } 0.51 (0.020) \text{ (M) T A (M) X}$

TABLE:

DIM	INCHES		MILLIMETERS	
	MIN	MAX	MIN	MAX
A	—	1.775	—	45.08
B	—	1.085	—	27.56
C	—	0.840	—	21.34
D	0.018	0.022	0.46	0.56
E	0.465	0.510	11.81	12.95
F	0.300	0.325	7.62	8.25
G	0.100 BSC	—	2.54 BSC	—
J	0.156 BSC	—	3.96 BSC	—
K	0.315	0.355	8.00	8.50
L	1.00 BSC	—	25.40 BSC	—
N	0.165 BSC	—	4.19 BSC	—
P	0.100 BSC	—	2.54 BSC	—
Q	0.148	0.168	3.76	4.27
R	—	0.600	—	15.24
S	1.500 BSC	—	38.10 BSC	—
U	0.200 BSC	—	5.08 BSC	—
V	—	0.250	—	6.35
W	0.435	0.450	11.05	11.43
X	0.400 BSC	—	10.16 BSC	—
Y	0.152	0.163	3.85	4.15

STYLE 1:
 PIN 1: RF INPUT
 2: GROUND
 3: GROUND
 4: DELETED
 5: VDC
 6: DELETED
 7: GROUND
 8: GROUND
 9: RF OUTPUT

**CASE 714Y-03
 ISSUE D**

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part. Motorola and are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

Mfax is a trademark of Motorola, Inc.

How to reach us:

USA/EUROPE/Locations Not Listed: Motorola Literature Distribution;
 P.O. Box 5405, Denver, Colorado 80217. 1-303-675-2140 or 1-800-441-2447

JAPAN: Nippon Motorola Ltd.: SPD, Strategic Planning Office, 4-32-1,
 Nishi-Gotanda, Shinagawa-ku, Tokyo 141, Japan. 81-3-5487-8488

Customer Focus Center: 1-800-521-6274

Mfax™: RMFAX0@email.sps.mot.com – TOUCHTONE 1-602-244-6609
 Motorola Fax Back System – US & Canada ONLY 1-800-774-1848
 –http://sps.motorola.com/mfax/

ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd.; 8B Tai Ping Industrial Park,
 51 Ting Kok Road, Tai Po, N.T., Hong Kong. 852-26629298

HOME PAGE: http://motorola.com/sps/

