

Features

- Low TCR (75 ppm/°C)
- High current capability
- Ultra low resistance values

Applications

- Power supplies
- Motor drives
- Electricity metering

PWR3920 S Series Power Resistor

Electrical Characteristics

Parameter	Value	Unit
Resistance Range	0.2, 0.3, 0.5, 1.0, 2.0. 3.0, 4.0	milliohms
Power Rating @ 70 °C	3.0	W
Tolerance	1, 5	%
Temperature Coefficient (TCR)	±75	PPM/°C
Operating Temperature	-65 to +170	°C
Maximum Operating Voltage	√PxR	

General Information

The Bourns® PWR3920 Series is a surface mount shunt resistor offering up to 3 W of power and very low resistance values as well as excellent TCR characteristics. It is designed for applications such as motor drives and power supplies.


Environmental Characteristics


Description	Method	Limit (∆R)
Short Time Overload	5 x Rated Power for 5 Seconds	± (1.0 % +0.0005 Ω)
High Temperature Storage	1000 Hours at ≠ 175 °C	± (1.0 % +0.0005 Ω)
Vibration	Frequency varied 10 to 2000 Hz in 1 Minute, 3 Directions, 12 Hours	± (0.5 % +0.0005 Ω)
Mechanical Shock	100 g for 6 Milliseconds, 5 Pulses	± (0.5 % +0.0005 Ω)
Load Life	1000 Hours at + 70 °C, 1.5 Hours "ON", 0.5 Hours "OFF"	± (0.5 % +0.0005 Ω)
Bias Humidity	35 °C, 65 % RH, 10 % Blas, 1000 Hours	± (0.5 % +0.0005 Ω)
Resistance to Solder Heat	+260 °C Solder, 10 - 12 Second Dwell, 25 mm/Second	± (0.5 % +0.0005 Ω)
Low Temperature Storage	65 °C for 45 Minutes	± (0.5 % +0.0005 Ω)
Load Life	√ FxR) for 1000 Hours, 1.5 Hours "ON", 0.5 Hours "OFF"	± (1.0 % +0.0005 Ω)
Moisture Resistance	MIL-81D-202, Method 106, 0 % Power, 7a and 7b Not Required	± (0.5 % +0.0005 Ω)
Resistance to Soldering Heat	260 °C for 10 Seconds	± (0.5 % +0.0005 Ω)
Thermal Shock	1000 Cycles from -55 °C to +150 °C, 15 Minutes at Temperature	± (0.5 % +0.0005 Ω)

PWR3920 S Series Power Resistor

BOURNS®


Product Dimensions

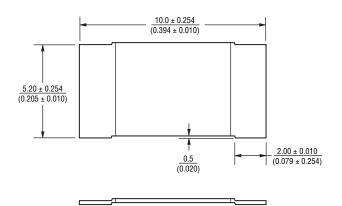

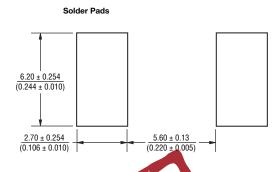

DIMENSIONS = MILLIMETERS

How to Order

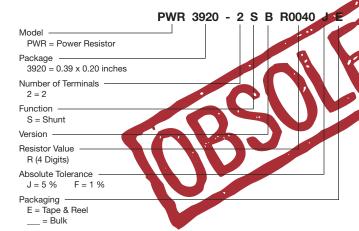

Packaging Specifications



Reliable Electronic Solutions

Asia-Pacific:

Tel: +886-2 2562-4117 • Fax: +886-2 2562-4116

Europe:

Tel: +41-41 768 5555 • Fax: +41-41 768 5510

The Americas:

Tel: +1-951 781-5500 • Fax: +1-951 781-5700

www.bourns.com