## Features/Benefits

- Long life—4M operations
- Sealed contacts
- Quality construction
- Quick and easy installation

## **Typical Applications**

- Automotive sensors and indicators
- Industrial sensors
- Factory automation equipment



# **Specifications**

CONTACT RATINGS: 3.0 W max. @ 30 V DC or 30 V AC max. @ 0.3 AMP max.; 1.0 msec. max. operate time (including bounce); 1.0 AMP max. carry current.

CONTACT RESISTANCE: 100 m  $\Omega$  max. initial.

DIELECTRIC STRENGTH: 200 V DC min.

ELECTRICAL CIRCUIT: SPST NO (Contact Form A). Reed switch opens when magnet is removed from proximity. Contacts are held closed when magnet is within actuation range.

OPERATING TEMPERATURE: -40°F to 212°F (-40°C to 100°C).

OPERATING DISTANCE/ALIGNMENT: Operate (pull-in or make) points are nominal values with ± 10% tolerance. Release points are 110% to 150% of the operating points.

MECHANICAL & ELECTRICAL LIFE: 4 million operations.

PACKAGING: Bulk packaging, 10 switch and magnet pairs per package.

#### **Materials**

HOUSING/SPACER/COVER: ABS plastic (UL94V-0), white.

REED SWITCH: Rhodium coated reed contacts in hermetically sealed, nitrogen filled glass capsule. Closed when magnet is in close proximity. Used in closed loop circuits.

WIRE LEADS: UL 1061, 22 AWG wire: stranded, made of copper or aluminum; Length: 12 in. with ends stripped; Color: white.

POTTING (around wires): Epoxy.

PART NUMBER

MPS45WGW

UL 61058-2

MAGNETS: MPS45WGW: NdFeB

MPS80WGW: Ceramic Ferrite 8
All other models: Alnico V

ADHESIVE MOUNTING: Foam-backed, pressure-sensitive adhesive

SWITCH TYPE

Subminiature surface mount (adhesive


or flange), side exit leads, 1" make gap


with release liner (MPS45WGW model only).


**NOTE:** Specifications and materials listed above are for switches with standard options. For information on specific and custom switches, consult Customer Service Center.

#### **How To Order**

Complete part numbers for MPS Series Magnetic Proximity Sensors are shown on pages E-35 thru E-39.

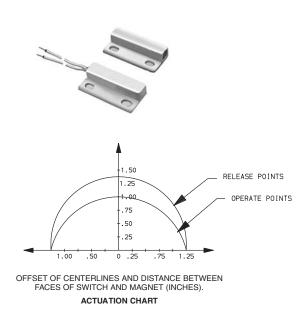

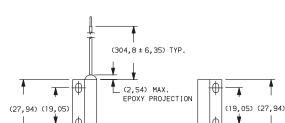

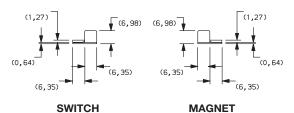

ALIGNMENT DOT(S)




Dimensions are shown: mm Specifications and dimensions subject to change




NOTE: UL 61058-2 Rating

www.ck-components.com


# MPS Series Magnetic Proximity Sensors

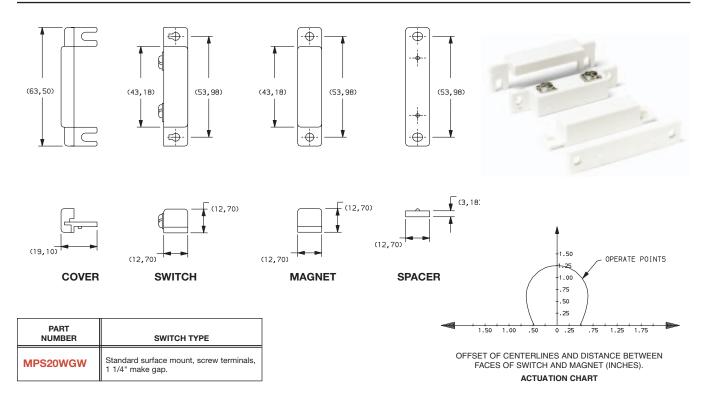

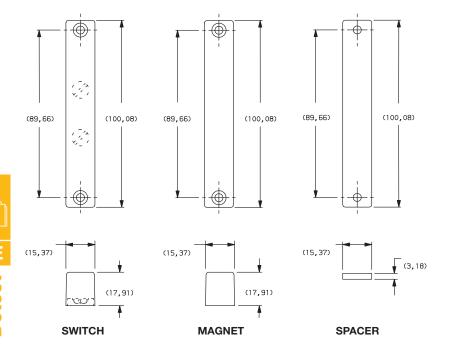

PART NUMBER	SWITCH TYPE
MPS80WGW	Industrial surface mount, concealed screw terminals, 2" make gap.



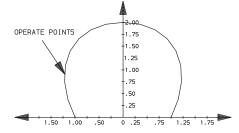

OFFSET OF CENTERLINES AND DISTANCE BETWEEN FACES OF SWITCH AND MAGNET (INCHES).


ACTUATION	CHART
ACTUATION	V CHANI




Dimensions are shown: mm Specifications and dimensions subject to change



# MPS Series Magnetic Proximity Sensors

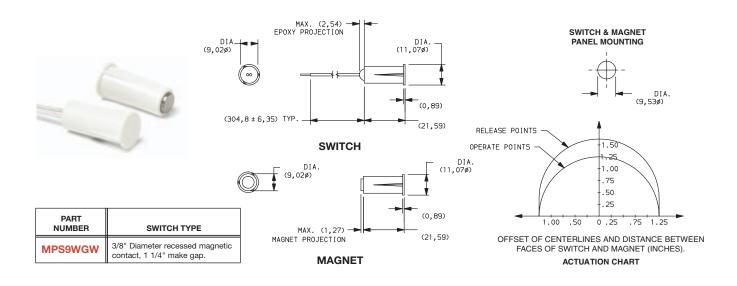

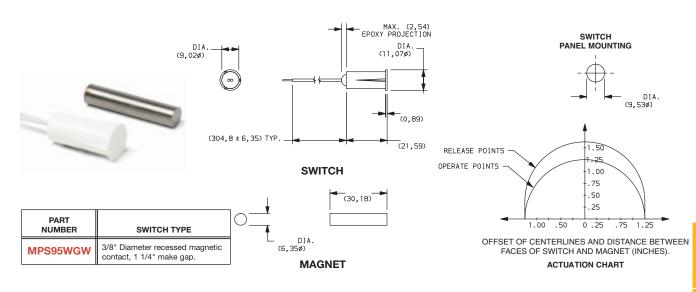













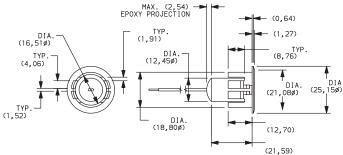


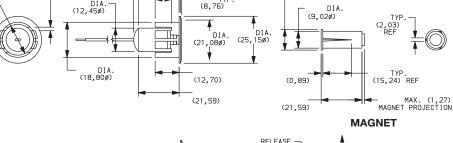

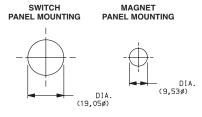


PART NUMBER	SWITCH TYPE
MPS73WGW	3/4" Diameter recessed magnetic contact, 1 1/4" make gap.

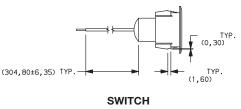

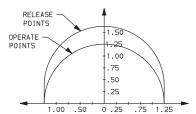


DIA. (11,07ø)

OFFSET OF CENTERLINES AND DISTANCE BETWEEN FACES OF SWITCH AND MAGNET (INCHES). **ACTUATION CHART** 

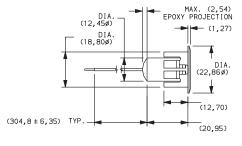




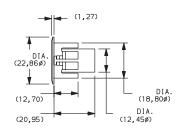




SWITCH & MAGNET

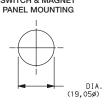

PART NUMBER	SWITCH TYPE
MPS70WGW	3/4" Diameter recessed magnetic contact, 1 1/4" make gap.

**MAGNET** 

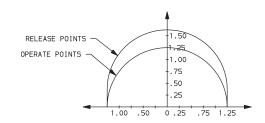

OFFSET OF CENTERLINES AND DISTANCE BETWEEN FACES OF SWITCH AND MAGNET (INCHES).

**ACTUATION CHART** 



Dimensions are shown: mm Specifications and dimensions subject to change



# **MPS Series Magnetic Proximity Sensors**

## **Actuating Positions**

When installing recessed and surface mount contacts, magnet position Gap distance is a combination of the horizontal and vertical plane sepis very important. The switch and magnet must always be parallel or end to end, and never in a 'T' configuration.

## **Gap Distance**

aration of the switch and magnet. Example: if a recessed magnet is 1/4" off the centerline of the switch, the make gap is reduced by 1/4"

### **Correct Configuration**



# **Incorrect Configuration**



### **Center Alignment**



### **Off Center Alignment**

